




MIAMI, FLORIDA

186  
AL-5349 (FAA)

LOM TM <b>266</b>	APP CRS <b>092°</b>	Rwy Idg 4999
		TDZE 8
		Apt Elev 8

**NDB or GPS RWY 9R**  
MIAMI/KENDALL-TAMIAMI EXECUTIVE (TMB)

MALS R MISSED APPROACH: Climbing left turn to 1700 direct TM LOM and hold.					
ATIS <b>124.0</b>	MIAMI APP CON <b>125.5 354.1</b>	MIAMI RADIO <b>123.65</b>	TAMIAMI TOWER* <b>118.9 (CTAF)</b>	GND CON <b>121.7</b>	CLNC DEL <b>133.0</b>

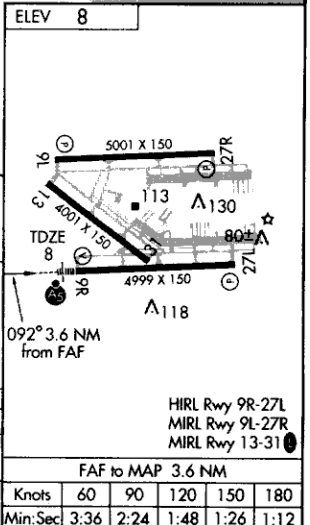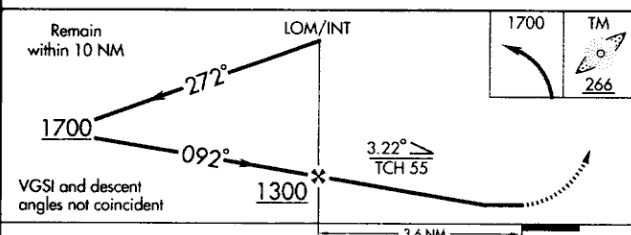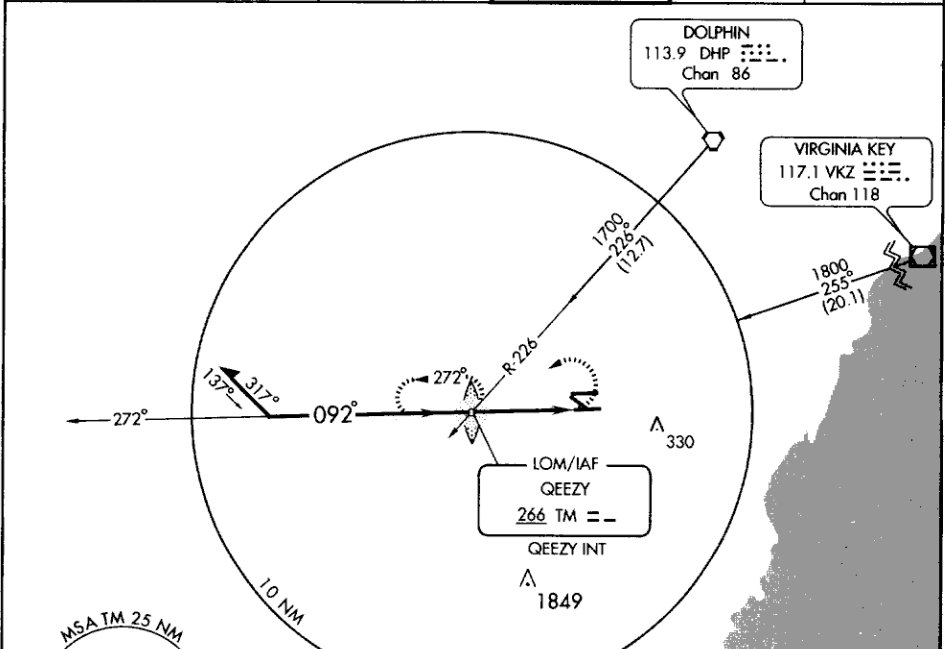

CATEGORY	A	B	C	D
S-9R	420- $\frac{3}{4}$	412 (500- $\frac{3}{4}$ )		420-1 412 (500-1)
CIRCLING	480-1 472 (500-1)	520-1 512 (600-1)	520-1 $\frac{1}{2}$ 512 (600-1 $\frac{1}{2}$ )	680-2 $\frac{1}{4}$ 672 (700-2 $\frac{1}{4}$ )

HIRL Rwy 9R-27L  
MIRL Rwy 9L-27R  
MIRL Rwy 13-31

FAF to MAP 3.6 NM					
Knots	60	90	120	150	180
Min:Sec	3:36	2:24	1:48	1:26	1:12

MIAMI, FLORIDA  
Amdt 1B 03079

25° 39' N - 80° 26' W

**NDB or GPS RWY 9R**

SE-3, 20 MAR 2003

SE-3, 20 MAR 2003